Work Order 349787 Details Additional ut inspection beyond osi inspection_deffered during 2011 S/D



WO Priority

4

WO CBD

Path

RI \ DR \ 2DD \ 0955 \ 0955-PIPE \ 0955-007 \ 0955-007-001 (EQ)

EQ Location

0955-007-001 : C-1100 NO. 4 SIDECUT OUTLET

Asset

0000110906: FIXED EQUIPMENT, PIPING, PROCESS

'Report 0040b

Richmond Refinery

	Work-Sub Type	RM-IR (Routine Maint \ Inspection Recommendation)							
	Status	ACTIVE (WO - Has Task(s) In-Progress)							
•	Safety?	No							
	Mechanical?	No							
	Attributes	MOC-NA							

Isolation Action

,	Status History								
	Status		Change Date	Change By					
	DRAFT .		24-JAN-2012	TBEA					
	WAPPR1		24-JAN-2012	TBEA -					
	APRVD		24-JAN-2012	SIPR					
	PLAN		24-JAN-2012	RNHO -					
	ACTIVE	'	24-JAN-2012	RNHQ					

Asset Criticality	Warranty Expiration
Brass Tag # 0955 007 001 2 5	Legacy UTC 0000110906 6
Classification 221	Asset Up?

Failure Class PPIP	Rolled Up Est Cost	\$0.00
Problem Code	Actual Cost to Date	\$3,923.25
Cause	Cost Type	MAINT
Remedy	Cost Object	K.DCRRI00281
Eg Breakdown? No		

SCD	MCD		ECD
		_	

Reported By

Beauregard, John

INSPECTION Phone # 242-5187 Phone #

Date Reported 24-Jan-2012

On Behalf Of

Add'l Contact

Description

ADDITIONAL UT INSPECTION BEYOND OSI INSPECTION_DEFFERED DURING 2011 S/D

Long Description INFORMATION

During the 4Q 2011 4 Crude unit S/D the 4 S/C line in the crude unit was found thinning due to sulfidation corrosion. The 8? carbon steel section leaving the column, C-1100 to the P-1149 pumps was not replaced at this time. It was determined that the circuit would make the 5 year run based on corrosion rates and a calculated T-Min. This inspection is in lieu of the high temp sensors denied on TAW 16221. REC-96599

DED Info

Copyright © 2012 Company Confidential Run by DMVM~MAXPROD 09-Aug-12 12:20 Page 1 of 4

Work Order 349787 Details ADDITIONAL UT INSPECTION BEYOND OSI INSPECTION_DEFFERED DURING 2011 S/D



WO Priority Path WO CBD

EQ Location Asset RI \ DR \ 2DD \ 0955 \ 0955-PIPE \ 0955-007 \ 0955-007-001 (EQ) 0955-007-001: C-1100 NO. 4 SIDECUT OUTLET

0000110906: FIXED EQUIPMENT, PIPING, PROCESS

Report 0040b

Richmond Refinery

For the P-1149 suction piping t(min):

- 1. 8? pipe:
- a. Pressure t(min) = 0.018 inch
- b. Structural t(min) = 0.036 inch

RECOMMENDATIONS

- Provide a budget for a series of 2 complete inspections on this circuit.
- 2. Perform baseline RT inspection at all additional Data point.
- 3. Perform follow up inspection at selected data points on 6 month intervals and extend the intervals based on the information.
- Look into installing high temperature sensors on the circuit to monitor corrosion rates.

Contact John Beauregard 2-5187 with questions or concerns.

**Material, Fabrication, Welding, Inspection and Testing shall be performed in accordance with the Richmond Refinery - Metals Craft, Quality Assurance Procedures.

WO Attachments? No

Hazards & R	equirements Record ID	Description	
_Hazardv	_*OTHER	Other Hazard Not On List	
Requirement	*OTHER .	Other Req / Precaution (Use Long Text)>	
Requirement	PERMIT	Permit(s) Required/Specify	

Tasks for Work Order Task Seg Planner Crew	Description	Status	Current S	atusChange By
001 RNHO	MISTRAS/ Additional UT inspection beyond OSI inspection_deffered during 2011 S/D	INPRG	28-FEB-2012	LWLE

Copyright © 2012 Company Confidential Run by DMVM~MAXPROD 09-Aug-12 12:20 Page 2 of 4

Work Order 349787 Details ADDITIONAL UT INSPECTION BEYOND OSI INSPECTION_DEFFERED DURING 2011 S/D



WO Priority

WO CBD

Path

RI \ DR \ 2DD \ 0955 \ 0955-PIPE \ 0955-007 \ 0955-007-001 (EQ) 0955-007-001: C-1100 NO. 4 SIDECUT OUTLET

· EQ Location

Asset

0000110906: FIXED EQUIPMENT, PIPING, PROCESS

Report 0040b

Richmond Refinery

Summary Costs Task Description		Total Est Mat'l	New York Control		Januari Line and H	MARKET HE STATE OF THE STATE OF	1986 30 10 20 66 10 10	Mary Control	uals = \$ Svc	用金数 出版 出版的现在分词	
349787-001 MISTRAS/ Additional UT inspection beyond OSI	0	0	0	•	0	. 0	3723	0	.0	200	3923

Copyright © 2012 **Company Confidential** Run by DMVM~MAXPROD 09-Aug-12 12:20

Work Order 349787 Details ADDITIONAL UT INSPECTION BEYOND OSI INSPECTION_DEFFERED DURING 2011 S/D



WO Priority

4

Report Summary & Selection Criteria

WO CBD

Path

RI \ DR \ 2DD \ 0955 \ 0955-PIPE \ 0955-007 \ 0955-007-001 (EQ)

EQ Location

0955-007-001 : C-1100 NO. 4 SIDECUT OUTLET

Asset

0000110906: FIXED EQUIPMENT, PIPING, PROCESS

Report 0040b

Total Work Orders Reported:

Richmond Refinery

PassedParameters: mroApp = WOTRACK; AppWhere = ((workorder.workorderid = 1002006)); ReportWhere = ; pTaskDisplay = ; OrgID = 0061; SiteID = DRRI;

Copyright © 2012 Company Confidential Run by DMVM~MAXPROD 09-Aug-12 12:20 Page 4 of 4